

SECTION 1: Identification of the substance/mixture and of the company/undertaking

1.1. Product identifier

Product name : AVM Adhesive 501
 Product form : Mixture

1.2. Relevant identified uses of the substance or mixture and uses advised against

Use of the substance/mixture : Primer

1.3. Details of the supplier of the safety data sheet

AVM Industries, Inc.
 8245 Remmet Ave
 Canoga Park, CA 91304
 Tel: 818-888-0050
 Fax: 818-888-0030
 www.avmindustries.com

1.4. Emergency telephone number

No additional information available

SECTION 2: Hazards identification

2.1. Classification of the substance or mixture

GHS-US classification

Flam. Liq. 2 H225
 Skin Irrit. 2 H315
 Eye Irrit. 2 H319
 Carc. 1B H350
 Repr. 2 H361
 STOT SE 3 H336
 STOT RE 2 H373
 Asp. Tox. 1 H304

2.2. Label elements

GHS-US labelling

Hazard pictograms (GHS-US) :



GHS02

GHS07

GHS08

Signal word (GHS-US) :

Danger

Hazard statements (GHS-US) :

H225 - Highly flammable liquid and vapour
 H304 - May be fatal if swallowed and enters airways
 H315 - Causes skin irritation
 H319 - Causes serious eye irritation
 H336 - May cause drowsiness or dizziness
 H350 - May cause cancer
 H361 - Suspected of damaging fertility or the unborn child
 H373 - May cause damage to organs through prolonged or repeated exposure

Precautionary statements (GHS-US) :

P201 - Obtain special instructions before use
 P202 - Do not handle until all safety precautions have been read and understood
 P210 - Keep away from heat, open flames, sparks. - No smoking
 P233 - Keep container tightly closed
 P240 - Ground/Bond container and receiving equipment
 P241 - Use explosion-proof electrical, lighting, ventilating equipment
 P242 - Use only non-sparking tools
 P243 - Take precautionary measures against static discharge
 P260 - Do not breathe mist, vapours
 P264 - Wash hands, forearms and face thoroughly after handling
 P271 - Use only outdoors or in a well-ventilated area
 P280 - Wear eye protection, protective gloves, protective clothing, respiratory protection
 P301+P310 - IF SWALLOWED: Immediately call a POISON CENTER, a poison center
 P302+P352 - If on skin: Wash with plenty of soap and water
 P303+P361+P353 - IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water/shower
 P304+P340 - IF INHALED: Remove person to fresh air and keep comfortable for breathing
 P305+P351+P338 - IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing

AVM Adhesive 501

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

P308+P313 - If exposed or concerned: Get medical advice/attention
P312 - Call a POISON CENTER, a poison center if you feel unwell
P314 - Get medical advice/attention if you feel unwell
P321 - Specific treatment (see first aid instructions on this label)
P331 - Do NOT induce vomiting
P332+P313 - If skin irritation occurs: Get medical advice/attention
P337+P313 - If eye irritation persists: Get medical advice/attention
P362+P364 - Take off contaminated clothing and wash it before reuse
P370+P378 - In case of fire: Use carbon dioxide (CO₂), dry extinguishing powder, foam to extinguish
P403+P233+P235 - Store in a well-ventilated place. Keep container tightly closed. Keep cool
P405 - Store locked up
P501 - Dispose of contents/container to a licensed hazardous-waste disposal contractor or collection site except for empty clean containers which can be disposed of as non-hazardous waste

2.3. Other hazards

No additional information available

2.4. Unknown acute toxicity (GHS US)

No data available

SECTION 3: Composition/information on ingredients

3.1. Substances

Not applicable

3.2. Mixtures

Name	Product identifier	%
tert-Butyl acetate	(CAS-No.) 540-88-5	20 - 40*
Distillates, petroleum, solvent-dewaxed heavy paraffinic	(CAS-No.) 64742-65-0	5 - 25*
Toluene	(CAS-No.) 108-88-3	2 - 20*

*In accordance with paragraph (i) of the OSHA Hazard Communication Standard (29 CFR §1910.1200), the specific chemical identity or exact weight % has been withheld as a trade secret

SECTION 4: First aid measures

4.1. Description of first aid measures

First-aid measures general : If exposed or concerned, get medical attention/advice. Show this safety data sheet to the doctor in attendance. Wash contaminated clothing before re-use. Never give anything to an unconscious person.

First-aid measures after inhalation : IF INHALED: Remove to fresh air and keep at rest in a position comfortable for breathing. Get medical attention if breathing is affected. If breathing is difficult, supply oxygen.

First-aid measures after skin contact : IF ON SKIN (or clothing): Remove affected clothing and wash all exposed skin with water for at least 15 minutes. If irritation develops or persists, get medical attention.

First-aid measures after eye contact : IF IN EYES: Immediately flush with plenty of water for at least 15 minutes. Remove contact lenses if present and easy to do so. Continue rinsing if pain, blinking, or irritation develops or persists, get medical attention. Continue rinsing.

First-aid measures after ingestion : IF SWALLOWED: rinse mouth thoroughly. Do not induce vomiting without advice from poison control center. Get medical attention if you feel unwell.

4.2. Most important symptoms and effects, both acute and delayed

Symptoms/effects : May be fatal if swallowed and enters airways. Causes skin irritation. Causes serious eye irritation. May cause drowsiness or dizziness. May cause cancer. Suspected of damaging fertility. Suspected of damaging the unborn child. May cause damage to organs through prolonged or repeated exposure.

Symptoms/effects after inhalation : May cause drowsiness or dizziness.

Symptoms/effects after skin contact : Causes skin irritation.

Symptoms/effects after eye contact : Causes serious eye irritation.

Symptoms/effects after ingestion : May be fatal if swallowed and enters airways.

Chronic symptoms : May cause cancer. Suspected of damaging fertility. Suspected of damaging the unborn child. . May cause damage to organs through prolonged or repeated exposure.

4.3. Indication of any immediate medical attention and special treatment needed

No additional information available.

SECTION 5: Firefighting measures

5.1. Extinguishing media

Suitable extinguishing media : Water fog. Foam. Dry chemical. carbon dioxide (CO₂).

5.2. Special hazards arising from the substance or mixture

Fire hazard : Highly flammable liquid and vapour.

AVM Adhesive 501

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Explosion hazard	: Heating may cause an explosion.
Reactivity	: No dangerous reactions known under normal conditions of use.
5.3. Advice for firefighters	
Precautionary measures fire	: Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking.
Firefighting instructions	: Use water spray or fog for cooling exposed containers. Exercise caution when fighting any chemical fire. Do not dispose of fire-fighting water in the environment.
Protection during firefighting	: Do not enter fire area without proper protective equipment, including respiratory protection.
Other information	: Avoid smoke inhalation.

SECTION 6: Accidental release measures

6.1. Personal precautions, protective equipment and emergency procedures

General measures : Evacuate area. Ventilate area. Keep upwind. Spill should be handled by trained clean-up crews properly equipped with respiratory equipment and full chemical protective gear (see Section 8).

6.1.1. For non-emergency personnel

Protective equipment : Wear Protective equipment as described in Section 8.

Emergency procedures : Evacuate unnecessary personnel.

6.1.2. For emergency responders

Protective equipment : Wear suitable protective clothing, gloves and eye or face protection. Approved supplied-air respirator, in case of emergency.

6.2. Environmental precautions

Avoid release to the environment. Prevent entry to sewers and public waters.

6.3. Methods and material for containment and cleaning up

For containment : Contain any spills with dikes or absorbents to prevent migration and entry into sewers or streams.

Methods for cleaning up : Ventilate area. Eliminate ignition sources. Use only non-sparking tools. Soak up residue with an absorbent such as clay, sand or other suitable material. This material and its container must be disposed of in a safe way, and as per local legislation. Foam, especially high expansion foam, may be used to suppress vapors.

6.4. Reference to other sections

See Sections 8 and 13.

SECTION 7: Handling and storage

7.1. Precautions for safe handling

Precautions for safe handling : Do not handle until all safety precautions have been read and understood. Ensure proper electrical grounding procedures are in place. Avoid contact with skin, eyes and clothing. Do not breathe the mist, vapours. Wash hands and other exposed areas with mild soap and water before eating, drinking or smoking and when leaving work.

7.2. Conditions for safe storage, including any incompatibilities

Storage conditions : Keep away from ignition sources. Store in a well-ventilated place. Keep cool.

SECTION 8: Exposure controls/personal protection

8.1. Control parameters

Toluene (108-88-3)	
ACGIH TWA (ppm)	20 ppm
Remark (ACGIH)	Visual impair; female repro;
OSHA PEL (TWA) (ppm)	200 ppm
OSHA PEL (Ceiling) (ppm)	300 ppm (500 ppm Peak [10 minutes])
Distillates, petroleum, solvent-dewaxed heavy paraffinic (64742-65-0)	
Remark (ACGIH)	OELs not established
Remark (OSHA)	OELs not established
tert-Butyl acetate (540-88-5)	
ACGIH TWA (ppm)	200 ppm
Remark (ACGIH)	Threshold Limit Values (TLV Basis) Critical Effects - eye and upper respiratory tract irritation
OSHA PEL (TWA) (mg/m ³)	950 mg/m ³
OSHA PEL (TWA) (ppm)	200 ppm

AVM Adhesive 501

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

8.2. Exposure controls

Appropriate engineering controls : Provide adequate general and local exhaust ventilation. Use process enclosures, local exhaust ventilation, or other engineering controls to control airborne levels below recommended exposure limits. Use explosion-proof equipment with flammable materials. Ensure adequate ventilation, especially in confined areas.

Personal protective equipment : Gloves. Protective goggles. Wear chemically impervious apron over labcoat and full coverage clothing. Insufficient ventilation: wear respiratory protection.



Hand protection : Use gloves chemically resistant to this material when prolonged or repeated contact could occur. Gloves should be classified under Standard EN 374 or ASTM F1296. Suggested glove materials are: Neoprene, Nitrile/butadiene rubber, Polyethylene, Ethyl vinyl alcohol laminate, PVC or vinyl. Suitable gloves for this specific application can be recommended by the glove supplier.

Eye protection : Wear eye protection, including chemical splash goggles and a face shield when possibility exists for eye contact due to spraying liquid or airborne particles.

Skin and body protection : Wear long sleeves, and chemically impervious PPE/coveralls to minimize bodily exposure.

Respiratory protection : Use NIOSH (or other equivalent national standard) -approved dust/particulate respirator. Where vapor, mist, or dust exceed PELs or other applicable OELs, use NIOSH-approved respiratory protective equipment.

SECTION 9: Physical and chemical properties

9.1. Information on basic physical and chemical properties

Physical state	: Liquid
Color	: Red. Brown.
Odor	: characteristic. Solvent.
Odor Threshold	: No data available
pH	: No data available
Relative evaporation rate (butylacetate=1)	: No data available
Relative evaporation rate (ether=1)	: < 1
Melting point	: No data available
Freezing point	: No data available
Boiling point	: 97.8 °C (208 °F)
Flash point	: 16.7 °C (62.1 °F)
Auto-ignition temperature	: No data available
Decomposition temperature	: No data available
Flammability (solid, gas)	: No data available
Vapour pressure	: No data available
Relative vapour density at 20 °C	: > 1 (Air = 1)
Weight Per Gallon	: 7.87
Relative density	: No data available
Solubility	: No data available
Log Pow	: No data available
Log Kow	: No data available
Viscosity, kinematic	: No data available
Viscosity, dynamic	: No data available
Explosive properties	: No data available
Oxidising properties	: No data available
Explosive limits	: No data available

9.2. Other information

VOC content : 98 g/l < 5 % Volatile by Weight

SECTION 10: Stability and reactivity

10.1. Reactivity

No dangerous reactions known under normal conditions of use.

10.2. Chemical stability

Stable under recommended handling and storage conditions (see section 7).

AVM Adhesive 501

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

10.3. Possibility of hazardous reactions

None known.

10.4. Conditions to avoid

Static electricity. Heat. Sparks. Open flame.

10.5. Incompatible materials

Strong oxidizing agents.

10.6. Hazardous decomposition products

Carbon oxides (CO, CO₂).

SECTION 11: Toxicological information

11.1. Information on toxicological effects

Acute toxicity : Not classified

Toluene (108-88-3)	
LD50 oral rat	2600 mg/kg
LD50 dermal rabbit	12000 mg/kg
LC50 inhalation rat (mg/l)	12.5 mg/l/4h

tert-Butyl acetate (540-88-5)	
LC50 inhalation rat (mg/l)	> 2230 mg/m ³ 4 h

Skin corrosion/irritation	: Causes skin irritation.
Serious eye damage/irritation	: Causes serious eye irritation.
Respiratory or skin sensitisation	: Not classified
Germ cell mutagenicity	: Not classified
Carcinogenicity	: May cause cancer.
Reproductive toxicity	: Suspected of damaging fertility or the unborn child.
Specific target organ toxicity (single exposure)	: May cause drowsiness or dizziness.
Specific target organ toxicity (repeated exposure)	: May cause damage to organs through prolonged or repeated exposure.
Aspiration hazard	: May be fatal if swallowed and enters airways.
Symptoms/effects after inhalation	: May cause drowsiness or dizziness.
Symptoms/effects after skin contact	: Causes skin irritation.
Symptoms/effects after eye contact	: Causes serious eye irritation.
Symptoms/effects after ingestion	: May be fatal if swallowed and enters airways.
Chronic symptoms	: May cause cancer. Suspected of damaging fertility. Suspected of damaging the unborn child. May cause damage to organs through prolonged or repeated exposure.

SECTION 12: Ecological information

12.1. Toxicity

No additional information available

12.2. Persistence and degradability

No additional information available

12.3. Bioaccumulative potential

No additional information available

12.4. Mobility in soil

No additional information available

12.5. Other adverse effects

No additional information available

SECTION 13: Disposal considerations

13.1. Waste treatment methods

Waste treatment methods : Obtain the consent of pollution control authorities before discharging to wastewater treatment plants.

Product/Packaging disposal recommendations : Dispose in a safe manner in accordance with local/national regulations.

SECTION 14: Transport information

In accordance with DOT

Transport document description : UN1993 Flammable liquids, n.o.s. (contains: Toluene; tert-Butyl acetate), 3, II

AVM Adhesive 501

Safety Data Sheet

Prepared according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Toluene (108-88-3)

U.S. - Massachusetts - Right To Know List
U.S. - New Jersey - Right to Know Hazardous Substance List
U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List
U.S. - Pennsylvania - RTK (Right to Know) List


tert-Butyl acetate (540-88-5)

U.S. - Massachusetts - Right To Know List
U.S. - New Jersey - Right to Know Hazardous Substance List
U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List

SECTION 16: Other information

Indication of changes : Revision 1.0: New SDS Created.
Revision date : 03/22/2018
Other information : Author: BCS.

NFPA health hazard : 3 - Materials that, under emergency conditions, can cause serious or permanent injury.
NFPA fire hazard : 4 - Materials that rapidly or completely vaporize at atmospheric pressure and normal ambient temperature or that are readily dispersed in air and burn readily.
NFPA reactivity : 1 - Materials that in themselves are normally stable but can become unstable at elevated temperatures and pressures.

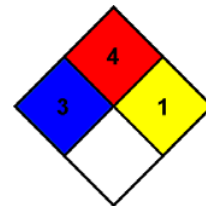

Hazard Rating

Health : 3*
Flammability : 4
Physical : 1
Personal protection :

This information is based on our current knowledge and is intended to describe the product for the purposes of health, safety and environmental requirements only. It should not therefore be construed as guaranteeing any specific property of the product